



E620 - E621



- Machine Taps
- Maschinen-Gewindebohrer
- Machinetappen
- Tarauds machine
- Machos de máquina
- Macho de Máquina

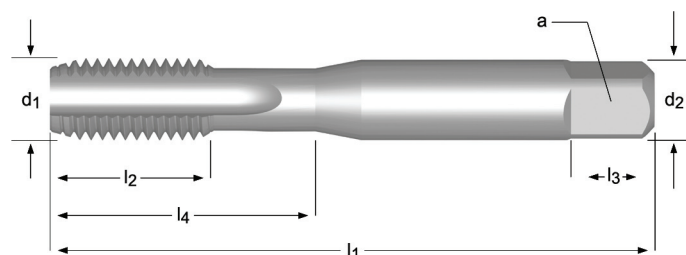


E620




- 1.1 1.2 1.3 1.4 1.5 3.1 3.2 3.3 3.4 6.1 6.2 6.3 6.4 7.2 7.3 7.4 8.2 8.3

M	P mm	d ₁ nom mm	l ₁ mm	l ₂ mm	d ₂ Ø mm	∅ a mm	l ₃ mm	z	↔	l ₄ mm	e-Code
3	0,50	3,65	53	14	4,00	3,15	6	3	2.6	14	E620M3
4	0,70	4,91	58	11	5,00	4,00	7	3	4.2	20	E620M4
5	0,80	6,04	66	13	6,30	5,00	8	3	5.2	26	E620M5
6	1,00	7,3	72	16	8,00	6,30	9	3	6.3	29	E620M6
8	1,25	9,62	80	18	10,00	8,00	11	3	8.4	32	E620M8
10	1,50	11,95	89	22	9,00	7,10	10	3	10.5		E620M10
12	1,75	14,27	95	24	11,20	9,00	12	4	12.5		E620M12
14	2,00	16,6	112	29	14,00	11,20	14	4	14.5		E620M14
16	2,00	18,6	112	29	14,00	11,20	14	4	16.5		E620M16

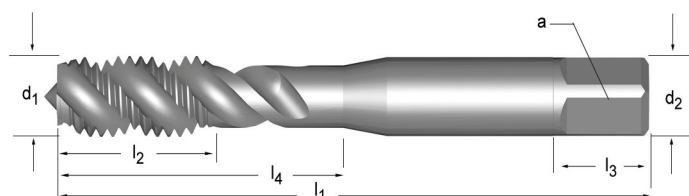

E621



- 1.2 1.3 1.4 1.5 2.1 2.2 2.3 5.2 7.1 7.2 7.3 7.4

M	P mm	d ₁ nom mm	l ₁ mm	l ₂ mm	d ₂ Ø mm	∅ a mm	l ₃ mm	z	↔	l ₄ mm	e-Code
3	0,50	3,65	53	14	4,00	3,15	6	3	2.6	14	E621M3
4	0,70	4,91	58	11	5,00	4,00	7	3	4.2	20	E621M4
5	0,80	6,04	66	13	6,30	5,00	8	3	5.2	26	E621M5
6	1,00	7,3	72	16	8,00	6,30	9	3	6.3	31	E621M6
8	1,25	9,62	80	18	10,00	8,00	11	3	8.4	34	E621M8
10	1,50	11,95	89	22	9,00	7,10	10	3	10.5		E621M10
12	1,75	14,27	95	24	11,20	9,00	12	3	12.5		E621M12
14	2,00	16,6	112	29	14,00	11,20	14	3	14.5		E621M14
16	2,00	18,6	112	29	14,00	11,20	14	3	16.5		E621M16