



# E303

**DORMER**

- Machine Taps
- Maschinen-Gewindebohrer
- Machinetappen
- Tarauds machine
- Machos de máquina
- Macho de Máquina

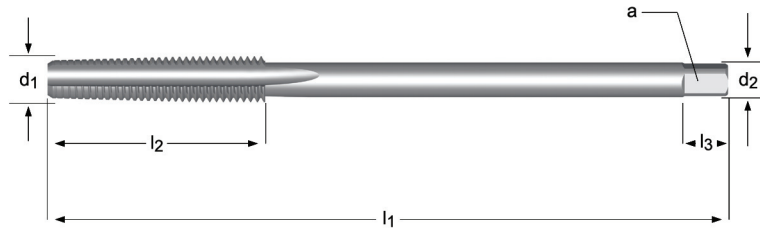

## E303



- 1.1 1.2 1.3 1.4 1.5 3.1 3.2 3.3 6.2 6.3 7.2 7.3 8.2

M	P mm	$l_1$ mm	$l_2$ mm	$d_2$ Ø mm	$\square$ a mm	$l_3$ mm	z		e-Code
3	0,50	70	22	2,2	-	-	3	2.5	E303M3NO1
3	0,50	70	22	2,2	-	-	3	2.5	E303M3NO3
3.5	0,60	80	25	2,5	2,1	5	3	2.9	E303M3.5NO1
3.5	0,60	80	25	2,5	2,1	5	3	2.9	E303M3.5NO3
4	0,70	90	25	2,8	2,1	5	3	3.3	E303M4NO1
4	0,70	90	25	2,8	2,1	5	3	3.3	E303M4NO3
5	0,80	100	28	3,5	2,7	6	3	4.2	E303M5NO1
5	0,80	100	28	3,5	2,7	6	3	4.2	E303M5NO3
6	1,00	110	32	4,5	3,4	6	3	5	E303M6NO1
6	1,00	110	32	4,5	3,4	6	3	5	E303M6NO3
8	1,25	125	40	6,0	4,9	8	3	6.8	E303M8NO1
8	1,25	125	40	6,0	4,9	8	3	6.8	E303M8NO3
10	1,50	140	45	7,0	5,5	8	3	8.5	E303M10NO1
10	1,50	140	45	7,0	5,5	8	3	8.5	E303M10NO3
12	1,75	180	50	9,0	7,0	10	3	10.3	E303M12NO1
12	1,75	180	50	9,0	7,0	10	3	10.3	E303M12NO3
14	2,00	200	56	11,0	9,0	12	3	12	E303M14NO1
14	2,00	200	56	11,0	9,0	12	3	12	E303M14NO3
16	2,00	200	63	12,0	9,0	12	3	14	E303M16NO1
16	2,00	200	63	12,0	9,0	12	3	14	E303M16NO3
18	2,50	220	63	14,0	11,0	14	3	15.5	E303M18NO1
18	2,50	220	63	14,0	11,0	14	3	15.5	E303M18NO3
20	2,50	250	70	16,0	12,0	15	3	17.5	E303M20NO1
20	2,50	250	70	16,0	12,0	15	3	17.5	E303M20NO3