


- Machine Taps
- Maschinen-Gewindebohrer
- Machinetappen
- Tarauds machine
- Machos de máquina
- Macho de Máquina

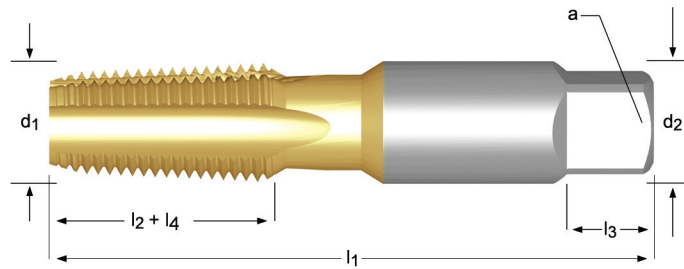

## E721

NPT HSS TiN ~ANSI B94.9 ↻ 🔧 NORMAL 1,5xD C 2-3 🔩

- 1.3 1.4 3.1 3.2 3.3 3.4
- 1.1 1.2 1.5 6.2 7.3 7.4 8.1

NPT	TPI	d <sub>1</sub> nom mm	l <sub>1</sub> mm	l <sub>2</sub> mm	d <sub>2</sub> ∅ mm	∠ a mm	l <sub>3</sub> mm	🔩	l <sub>4</sub> mm	z	e-Code
1/8	27	10,29	70	19	11,1	8,3	10	8.5	19	4	E7211/8
1/4	18	13,72	75	27	14,3	10,7	11	11	27	4	E7211/4
3/8	18	17,15	80	27	17,8	13,5	13	14.5	27	4	E7213/8
1/2	14	21,34	100	35	17,5	13,1	16	18		4	E7211/2
3/4	14	26,67	105	35	23,0	17,2	17	23		5	E7213/4
1	11.5	33,40	115	43	28,6	21,4	21	29		5	E7211