


E200

DORMER

- Machine Taps
- Maschinen-Gewindebohrer
- Machinetappen
- Tarauds machine
- Machos de máquina
- Macho de Máquina

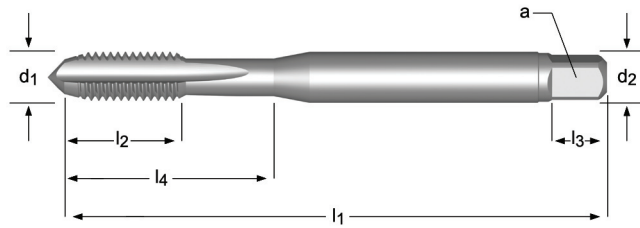

E200

M
HSCo
DIN 371
6H
1,5xD
A 6-8
C 2-3

- 1.1 1.2 1.3 1.4 1.5 3.1 3.2 3.3 6.2 6.3 7.2 7.3 8.2

M	P mm	l ₁ mm	l ₂ mm	d ₂ Ø mm	□ a mm	l ₃ mm	z	↔	l ₄ mm	e-Code
2	0,40	45	6	2,8	2,1	5	3	1.6	9	E200M2
2.2	0,45	45	7	2,8	2,1	5	3	1.75	12	E200M2.2
2.5	0,45	50	8	2,8	2,1	5	3	2.05	12,5	E200M2.5
3	0,50	56	9	3,5	2,7	6	3	2.5	18	E200M3
3	0,50	56	9	3,5	2,7	6	3	2.5	18	E200M3NO1
3.5	0,60	56	11	4,0	3,0	6	3	2.9	20	E200M3.5
4	0,70	63	12	4,5	3,4	6	3	3.3	21	E200M4
4	0,70	63	12	4,5	3,4	6	3	3.3	21	E200M4NO1
5	0,80	70	13	6,0	4,9	8	3	4.2	25	E200M5
5	0,80	70	13	6,0	4,9	8	3	4.2	25	E200M5NO1
6	1,00	80	15	6,0	4,9	8	3	5	30	E200M6
6	1,00	80	15	6,0	4,9	8	3	5	30	E200M6NO1
7	1,00	80	15	7,0	5,5	8	3	6	30	E200M7
8	1,25	90	18	8,0	6,2	9	3	6.8	35	E200M8
8	1,25	90	18	8,0	6,2	9	3	6.8	35	E200M8NO1
10	1,50	100	20	10,0	8,0	11	3	8.5	39	E200M10
10	1,50	100	20	10,0	8,0	11	3	8.5	39	E200M10NO1